

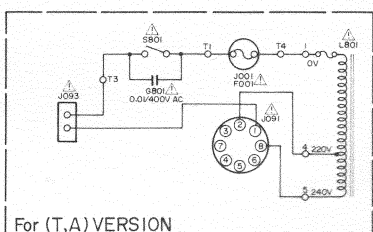


QJ01, QJ02 HT109702A0 25A970(GR or BL)	QJ03 ~ QJ06 QK05, QK06 HT326342B0 25C2634 (Ror S)	QJ07, QJ08 QK51, QK52 HT326342A0 25C2634 (Ror S)	QJ09, QJ10 HT318151B0 25C1815 (Y)	QJ11, QJ12, QK03 QK04, QK71 ~ QK73 HT30952D0 25C536 (Gor H)	QJ13 ~ QJ16 HT10151B0 25A1015 (Y)	QJ17, QJ18 HV00003120 MV-3	QJ19, QJ20, QK01 QK02, QK53, QK54 HT406552A0 25D655 (Dor E)	QK07, QK08 HC10052050 TD62504P	QK75, QK76 HT105642J0 25A5644 (R or S)	DK51, DK52 HD10004020 QA91
--	--	---	---	--	---	----------------------------------	--	--------------------------------------	--	----------------------------------


PJ01

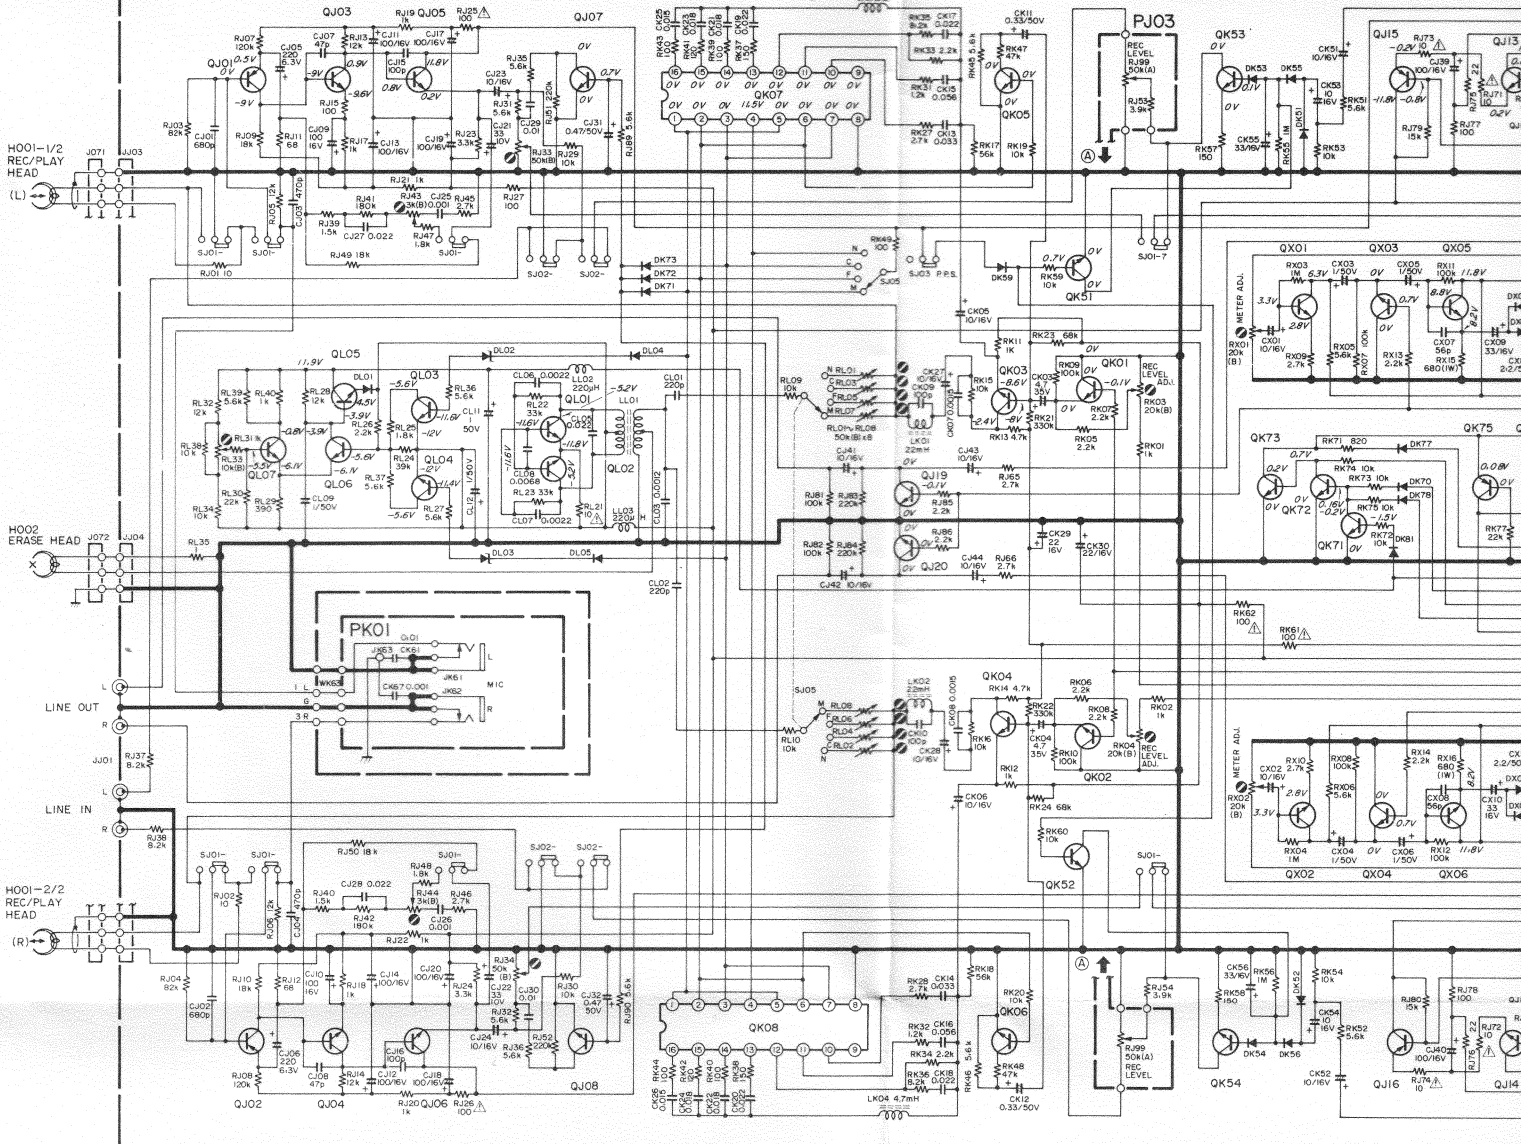

For (T,A) VERSION

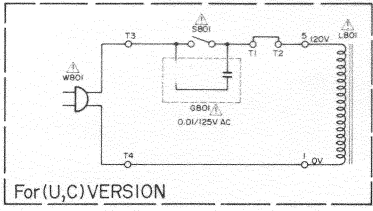


For (U,C) VERSION

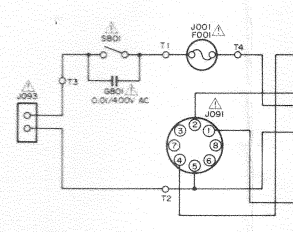

For (N,P) VERSION

P801

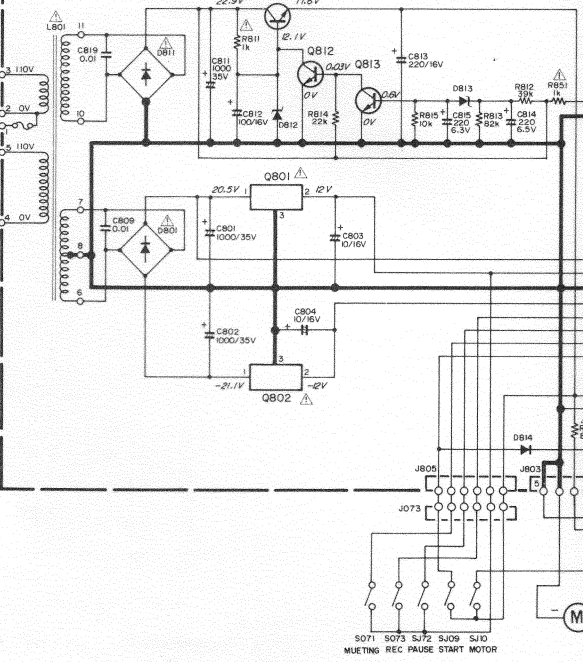


S071 S073 S172 S109 S110
MUTING REC PAUSE START MOTOR

SCHEMATIC DIAGRAM FOR MODEL SD5050

- Q802 HCl0044060 μPC7912H
- Q811 HT40313200 2SD313(E or F)
- Q812, Q813 HT318152A0 2SC1815(O or V)
- Q851 H10006320 GL9NG9
- D801 HD20021290 SIVB20
- D811 HD20026080 RB151-FA
- D812 HD30027090 WZ-140
- D813 HD30031090 WZ061
- D814 HD20022100 10E1-FA
- QX05, QX06 HT305362D0 2SC536(G or H)
- QX07, QX08 HH0003030 STD-04
- QX10 H11203320 LT-100B

P601

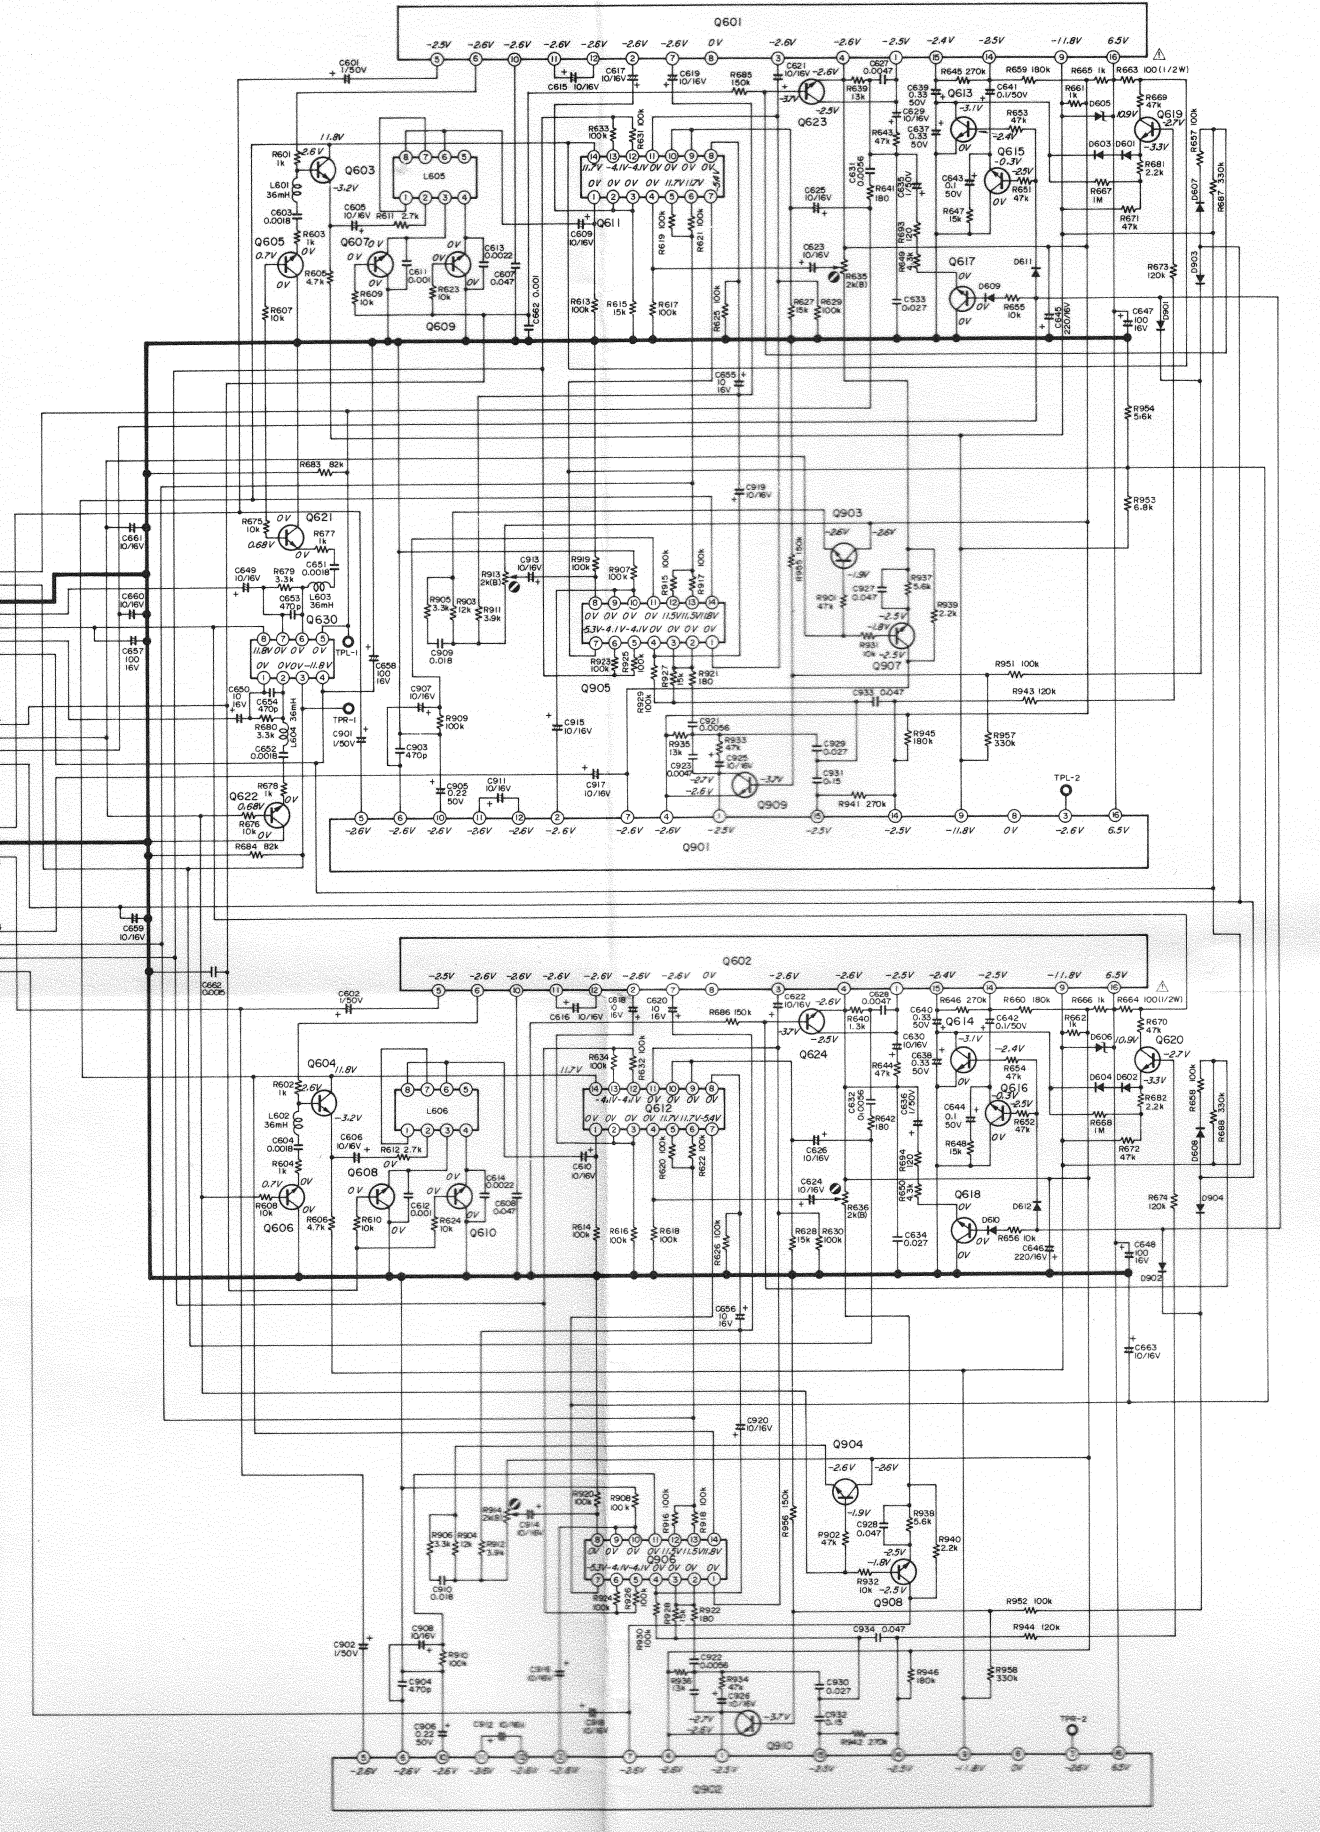

- DX01~DX04 HD10004020 OA91
- DX05, DX06 HD20011050 IS1555
- QX01, QX02 HT305362D0 2SC536(G or H)
- QX03, QX04 HT408552A0 2SD6591(D or E)
- DY01 HD20011050 IS1555
- DY01 H10014320 GL-9HY22
- DY02 H10015320 GL-9FR22
- DY03, DY04 H10013050 TLR122
- Q601 HCl0011270 NF645N
- Q603~Q610 Q613~Q625 Q907~Q910 HT305362C0 2SC536(F, G)
- Q611, Q611 HC406601B0 HD4066B
- Q630 HCl0013370 TL4558P
- Q631 H110002080 SEL1312G
- Q901, Q902 HCl0011270 NE645N
- Q905, Q906 HC406601B0 HD14066B
- D601, D602 D901~D904 HD200011050 IS1555
- D603, D604 HD10004020 OA91
- D605, D606 HD30030090 WZ-177